

# SIM900D Firmware Release Note

**Latest Version: 1137B10SIM900D64\_ST**

## **General Notes**

SIMCOM offers this information as a service to its customers, to support application and engineering efforts that use SIMCOM products. The information provided is based upon requirements specifically provided to SIMCOM by the customers. SIMCOM has not undertaken any independent search for additional relevant information, including any information that may be in the customer's possession. Furthermore, system validation of this SIMCOM product within a larger electronic system remains the responsibility of the customer or the customer's system integrator. All specifications supplied herein are subject to change.

## **Copyright**

This document contains proprietary technical information which is the property of SIMCOM Limited., copying of this document and giving it to others and the using or communication of the contents thereof, are forbidden without express authority. Offenders are liable to the payment of damages. All rights reserved in the event of grant of a patent or the registration of a utility model or design. All specification supplied herein are subject to change without notice at any time.

***Copyright © Shanghai SIMCom Wireless Solutions Limited. 2012***

# SIM900D GSM Cellular Engine

## 1 Preamble

This Release Note introduces SIM900D firmware versions and briefly describes the benefits over preceding release. Also you can find differences compared with preceding release.

**New Features:** list features or AT commands which are newly developed compared with the preceding version.

**Improved Features:** list features or parameters that have been changed or improved compared with the preceding version.

### Related documents

[1] SIM900 AT Command Set, V1.05

[2] SIM900D Hardware Design, V1.03

**Version: 1137B10SIM900D64\_ST****[New Features]**

1. Added "AT+FTPDELE" command to delete file.
2. Added "AT+FTPSIZE" command to require the size of gain file.
3. Added "AT+FTPSTATE" to read the state of FTP session.1 means in the FTP session,0 means not in the FTP session.
4. Added "AT+CWHITELIST" command to support white list function, only the number from the list is allowed to access, other numbers will be rejected directly without incoming call ring and any hints. It can set 30 numbers at most.
5. Added "AT+CNETLIGHT" command to close/open network light. 0 means close,1 means open.
6. Added AT+CMGS=">index" function to simplify short message sending operation.
7. Added "AT+CNETSCAN" command to scan available network when there is no card in the module.
8. Added three parameters of "AT+CIPCCFG" command: (Rxmode:0,1), (RxSize:50-1460), (RxTimer:20-1000). If Rxmode is set to 1, the function is enabled that the data received from network in transparent mode will be partitioned into small blocks then sent to serial port by time sharing processing.

**[Improved Features]**

1. Solved the problem that the first parameter of "AT+CBC" command is not change when the battery charging ended.
2. Modified some URC errors of CSD call in MUX mode.
3. Solved the problem that the voltage of 1.8v SIM card is still 3v after operating AT+CFUN=1 operation in some special cases.
4. Changed the initial return value of \*CELLLOCK reading command from 255 to 0.
5. Solved the problem that no response would return from serial port when SHUTDOWN the TCP/UDP connection immediately after it was established.
6. Solved the problem that the module will reset itself if customer sending the "AT+CBAND="EGSM\_DCS\_MODE" command quickly and repeatedly.
7. Optimized the command "AT+EXUNSOL="UR",1".
8. Solved the problem that after hanging up a unconnected call by HVOIC, ATDL command will not work.

9. Solved the problem if the module was reset by key depression, the information "SIM PUK2 required" will be shown when unlocking the pin after "AT+CFUN=1" operation.
10. Delete the extra response "OK" of "AT\*CELLLOCK=0" command.
11. Solved the problem that SMS process could not exit if the module enters into transparent mode during its editing process, it would cause the serial port impassable.

## Version: 1137B09SIM900D64\_ST

### [New Features]

1. Added a new AT command "AT+CIPTXISS" of TCP function. If it is set to 1 (enabled), the module cannot respond to AT commands when TCP is sending data to this port, the default value is 0 (disabled). It has no effect in transparent mode when it is enabled.
2. Added a new function of GSMBUSY command. By setting AT+GSMBUSY=2 user can reject all the voice calls but allowed CSD calls to access.
3. Added "AT+CR99" command to set the GPRS release number according to the user's operator. It can be set as 0 or 1. 1 means the default value 99, 0 means 97.
4. Added "AT+CEXTERNTONE" command to switch on/off audio function of MIC.
5. Added a parameter of HTTPPARA that customer can set http timeout period.
6. Added a parameter of HTTPPARA command that customer can set http context type.
7. Added "AT+CUSACC" command to accelerate uart speed.
8. Added "AT+CCHGMODE" command to acquire whether the module is charging while power off.

### [Improved Features]

1. Improved the recognition accuracy of keyboard.
2. Made the return value to be "ERROR" if user forwarded an inexistent SMS by executing "AT+CMSS" command.
3. Solved the problem that failure would occur if user forwarded some SMS.
4. Solved the problem that sender number of SMS would not be changed if this SMS was forward for several times.
5. Solved the problem that when "AT+CNMI=2,2" was set and user sent an empty SMS there was neither "+CMT" nor "+CDS" reported.
6. Solved the problem in MUX mode that when user closed a channel unconventionally, the serial port might be blocked if user operated TCP command after that.

7. Solved the problem that user could not activate a call successfully which was caused by STK.
8. Solved the problem that incoming call cannot be picked up automatically in transparent mode and SMS editing mode.
9. Made the default value of time set by SS command equivalent to that set by AT+CCFC command.
10. Solved the problem that user cannot write a SMS with the send number of 161 or 177 type.
11. Solved the problem that DCD pin cannot recover to high level itself in some special cases.
12. Fixed the bug that "MO CONNECT" cannot be reported in each Logic Channel.
13. Solved the problem that GPRS does not worked temporarily when ussd is sending IND signal.
14. Fixed the bug that the module may reset itself when the Intrade card receives short message.
15. Fixed the bug that the serial port would be blocked while using AT+HVOIC to hang up a call.
16. Solved the problem that there is no response returned from serial port when active a call with some card for Brazilian customer.
17. Optimized the network searching method to accelerate the speed of searching network in some special cases.
18. Modified the digital gain set problem of AT+AUDG command.
19. Fix a problem of crash when SIMCard bus is overloaded.
20. Solved the problem of DNS crash while using AT+CIPSHUT in decrypting process.
21. Fixed a bug that SIMCard cannot be recognized after read or delete SMS in "TIM" card.
22. Further improve the command "AT+CIPTXISS=1" to prevent the response of AT command mix in TCP data.
23. Under the condition that the module is in sleep mode and the RF is closed, the module will enter into super sleep mode, the net-light will be turned off for decreasing the decreasing the current consumption until the module exit the super sleep mode.
24. Solved the packet loss problem in mux mode during the PPP dial process in LINUX platform.

## Version: 1137B08SIM900D64\_ST

### [New Features]

1. Added the function to show percentage of battery while the module is charging.

### [Improved Features]

1. Solved the problem that URC (+CDRIND: <type>) would report voice mode if user was unable to connect a CSD call. (the other side was busy or no signal)
2. Altered the RI pin status when the module reported "RING" of incoming CSD call. If CRIPULSE is set to 1, it presents RI pulse otherwise it is continuously in high level.
3. Solved the problem that there was no ring back tone if user dialed a number of MAXIS sim card through the CELECOM sim card in Malaysia.
4. Solved the problem which happened after user sent a sms via AT command accidentally that the module would "freeze" for about 50 seconds before it replied, during that time, the module did not respond to any commands.
5. Solved the problem that SIM PIN2 couldn't be modified.
6. Solved the problem that the module couldn't attach to the GPRS network if it had activated GPRS previously and then restarted manually.
7. Solved the problem raised by Shenzhen customer that some special SIM card could not be recognized by the module.
8. Solved the problem that module reported overtime for some FTP server after it received data.
9. Solved the problem in Poland that the module would diconnect from the network after registered successfully priviously because of its missing of some SIM card files.

## Version: 1137B07SIM900D64\_ST

### [New Features]

1. Added "AT+SLEDS" command to configure the flicker frequency of network lights in the status of unregistered, registered or PPP.
2. Added "AT+CGAS" command to increase the speed of GPRS attachment since it is not necessary to re-attach each time.
3. Added the value "UR" to the parameter <exunsol> of "AT+EXUNSOL" command to support unsolicited result code.

### [Improved Features]

1. Solved the problem that it would fail easily when user activated GPRS context immediately after executing the "AT+CIPSHUT" command.
2. Modified the VTS function not to return OK until implementation was executed successfully.
3. Solved the problem that some of the CLCC and CLIP URC can not be reported normally in MUX mode.
4. Solved the problem of not reporting "NO ANSWER" in the case of calling the other side who was busy when user set "ATS7=15".
5. Solved the problem that voltage alarm urc was only reported in a logical serial port in MUX mode.
6. Modified the format of returning information when setting "AT+CENG=3".
7. Fixed the bug that executing ATA command can not pull RI to high level in MUX mode.
8. Fixed the bug that the local time converted by the time NITZ reported was wrong and "CI" of operator's name was wrong.
9. Solved the problem that it would take a long time for network indicator light to flash for some SIM cards when user powered on the module in roaming status.
10. Solved the problem that there is no response returned from serial port if user executes the following steps: 1. Plug out the SIM card and then dial emergency number. 2. Plug in the SIM card then execute "AT+CFUN=0" command.
11. Limited the scope of input parameters of AT+CRLP command.
12. Fixed the bug of CLCC, CLIP, CMGR command that Chinese name and English name could not display in UCS2 mode if user sets CSCS to UCS2 mode.
13. Modified the CPBW command when CSCS was set to HEX mode, the name could be written up to 28 characters.
14. Limited the scope of input parameters of "AT+CALD" command.
15. Modified the error response of AT command "AT+CSTA=", the error response should be "ERROR" instead of "OK".
16. Solved the problem that the responses of reading empty record in phone book via CPBR command were not consistent.
17. Modified the response of test command of EXUNSOL by adding the parameter value "UR".
18. Solved the problem that the module can not register to the network successfully with SIM card of Orange operator when user sets "AT+CBAND="ALL\_BAND"".
19. Added the content "resource limitation" of error code 99.

20. Solved the problem that the calling record of some special number can not be saved in recent call lists.
21. Solved the problem that the CSD connection can not be established successfully anymore after user dials a number in call record list in CSD mode.
22. Solved the problem that "CALL READY" will not report in some special conditions when URC presentation was enabled by executing CIURC command.
23. Solved the problem that no response would return from serial port if "AT\*PSENGMODE=0" is executed and modified the response format of test command to "\*PSENGMODE: (1) ".
24. Solved the problem that CTS varied when user sent or received AT command with no flow control.
25. Limited the scope of inputting parameter when executing HTTPREAD and HTTPDATA command in writing mode.
26. Solved the problem that Shenzhen customer can not originate a phone call or send SMS after a successful call.
27. Modified the VTS function not to return OK until implementation was executed successfully.
28. Optimized the SIDETONE function.
29. Optimized the CMIC function.
30. Resolved the problems that might arise when user charged the module which was in low voltage or charged it for a long time, and changed the cut-off current to 40mA.
31. Solved the reset problem when user input wrong value of parameter to change the frequency band.
32. Solved the problem that USSD information reported was incorrect found by Indian customer.
33. Solved the problem that unrecognizable code would be reported when user executed the CLCC or CLIP command to get information of an incoming call whose name was saved in the phonebook in UCS2 mode previously.

#### **Version: 1137B06SIM900D64\_ST**

#### **[New Features]**

1. Added the function to disable the sidetone algorithm.
2. Added "AT+CIPRXGET" command to get data from RX manually. If the parameter is 0, this function is closed and the module is set to normal mode, data will be pushed to



serial port directly; if the parameter is set to 1, user enables the function; if the parameter is set to 2, the module can get data, but the length of output data can not exceed 1460 bytes at a time; if the parameter is set to 3, it is in HEX mode, the module can get 730 bytes maximum at a time; and if the parameter is set to 4, user can also query how many data are not read with a given ID.

3. Added "AT+CIPQRCLOSE" command to speed up disconnection of the remote server. This function is disabled by default (0).
4. Added query status function to command "AT+CIPSTATUS", it will be valid only when CIPMUX=1, and it will report the status first, then return "OK".
5. Added the function that user can use ATD command to dial USSD.
6. Added "AT+CAAS" command to enable or disable the function to switch audio channel automatically and put a call through by hook key. But the headset detection function is still reserved, when AT+CEXTHS=1 is set, the status of headset plug in or out will be reported.
7. Added "AT+CIPSCONT" command to save APPTCP parameters in flash and support flash interface to save and load the value.
8. Added "AT+FTPSCONT" command to save FTP parameters in flash and support flash interface to save and load the value.
9. Added "AT+HTTPSCONT" command to save HTTP parameters in flash and support flash interface to save and load the value.
10. Added "AT+SAPBR" command to save SAPBR parameters in flash and support flash interface to save and load the value.
11. Added "AT+GSMBUSY" command, if it is set to 1, all the incoming calls can be rejected directly when there is no response from the module, this command is designed for the user's convenience in some special cases, such as simulating off-hooking dialing and no incoming call interruption during GPRS data transmission. This function is disabled by default (0).
12. Added the function of AT command "AT+SPWM" to support buzzer.

### [Improved Features]

1. Fixed the bug that the value of the current frequency band was not consistent with the value queried by the AT command.
2. Modified the problem that both CNUM and CPBR can not show the record written by CPBW command when "AT+CPBS="ON"" is set and some special SIM cards with the volume 1 are used.
3. Modified the power on voltage and set it to be 3.1v.

4. Fixed the problem that there is no RING message reported during a coming call if the corresponding name in the phonebook is blank.
5. Modified the default mic value of "AT+AUTEST" to be 18, and added a function to use "AT+AUTEST=0" separately to close headset channel loop, which is disabled in SIM900 or SIM900A products.
6. Modified the problem that call cannot be set up when vivacom Sim card is used.
7. Fixed the bug that wrong apn will lead to ppp dial exit failure.
8. Modified the SIM card unrecognizable problem in Taiwan.
9. Optimized the broken transfer resuming function of http.
10. Solved the problem that module could crash when user sets the CLVL continuously.
11. Fixed the bug that the record of a successful CSD call could not be saved in the phonebook.
12. Fixed the bug that the out of range hints of dialing record 0 by "ATD>" command when the current phonebook has no record were different from that when the current phonebook has records.
13. Modified the SIM900 problem that the module will reset if user executes "AT+CFUN=0" or changes the rate band by "AT+CBAND" command at module initiating time.
14. Modified the "AT+CENG" command to make it consistent with SIM300 series by enlarging the length of MNC to support 3 bytes; using number "99" to represent invalid parameter "rxquality" instead of "FF"; adding MCC and MNC information of neighborhood cell, changing the show location of LAC which is set to hex mode.
15. Fixed the problem that self adaptive baud rate was not precise which led to failure of baud rate adaption.
16. Modified the format error of "AT+CHFA" test command.
17. Modified the problem that the module would not receive any data which were sent immediately after the connection was established successfully if it is set to be a server.
18. Modified the problem that the module reported error information of incoming call when user used "ATH" command to hang up before the "RING" was reported, and it would ring continuously and maintain connected.

#### **Version: 1137B05SIM900D64\_ST**

#### **[New Features]**

1. Added HTTP and FTP functions.

2. Added "ME" phonebook function for "AT+CPBS".

#### [Improved Features]

1. Modified the problem that waiting tone intervals are not precise.
2. Fixed the bug that MUX can not be closed successfully when module is connected to WINCE platform through 3 serial port pins (RXD, TXD, GND).
3. Fixed the bug that CLCC reports error information when a CSD call is dialed after a CSD connection has been established already.
4. Modified the hands-free audio parameters by adding two additional settable parameters of es and of ses respectively for "AT+ECHO".
5. Modify the character case sensitive problem by using AT+CPBF command to search for phonebook entries.
6. Modified the problem that the module will not report error when some illegal characters are entered as parameters of "AT+CLDTMF" command.
7. Fixed the bug of "AT+CPBR" command, the display number of which was not converted to the right format under UCS2 mode.
8. Fixed the bug of wrong name display format when executing "AT+CCVM?" command under UCS2 mode.
9. Modified the problem that dial-up program can not be run successfully when module is connected to LINUX platform.
10. Modified the default parameters of "AT+CMUX" command to be "+CMUX: 0,0,5,127,10,3,30,10,2".
11. Fixed the problem that DCD pin does not return to low level if CSD call is dropped by pulling DTR to high level after AT&D2 is set.
12. Modified the problem that module will take long time to register network if changed to another SIM card which belongs to different network operator.
13. Changed the return of "ERROR" to "OK" when executing "AT+CMGR=1" command if there is no SMS on index 1, which is compatible with SIM300.
14. Optimized "AT+VTS" command that "AT+VTS=1" can be used to generate DTMF directly, which is compatible with SIM300.
15. Optimized the ATH function to make possible to hang up a call by sending consecutive ATH command when COLP is set to 1.
16. Discarded UDP data directly if the length exceeds 1460 bytes in a single package.
17. Improved the stability of reading SMS under low-speed baud rate.

18. Fixed the problem that "AT+HVOIC" command can not take effect under special cases.

## **Version: 1137B04SIM900D64\_ST**

### **[New Features]**

### **[Improved Features]**

1. Modified the problem that CLDTMF (local DTMF tone) and SIMTONE (specifically tone) are not precise.
2. Fixed some bugs of TCP.
3. Modified the multiplexing problem when module works in WINCE platform through 3 serial port pins (RXD, TXD, GND).
4. Modified the Multiband option value of CBAND.
5. Fixed the problem of audio channel loopback test.
6. Enhanced the testing ability of manufacture.